

# Keysight Technologies

## Tips for Querying CW and Average Power Without Compromising Measurement Accuracy

Application Brief

Using Keysight power meters and sensors

# Introduction

This application note applies to the following products from Keysight Technologies

- N1913/14A EPM power meter
- E4416/17A EPM-P power meter
- N1911/12A P-Series power meter
- U2020 X-Series USB peak and average power sensor
- U2000A Series USB average power sensor
- U8480A USB Thermocouple USB power sensor
- Keysight power sensors

This application brief demonstrates the capabilities Keysight Technologies, Inc. power meters and power sensors have for measuring CW and average power signals. It also explains the advantages and disadvantages of select SCPI commands and settings for Keysight power meters and power sensors, illustrating how to use these items to improve power measurement speed without compromising measurement accuracy.

## Power measurements

There are many ways to analyze a modulated signal. The power-versus-time measurement is a very useful method for examining power level changes due to pulsed or burst carriers (see Figure 1).

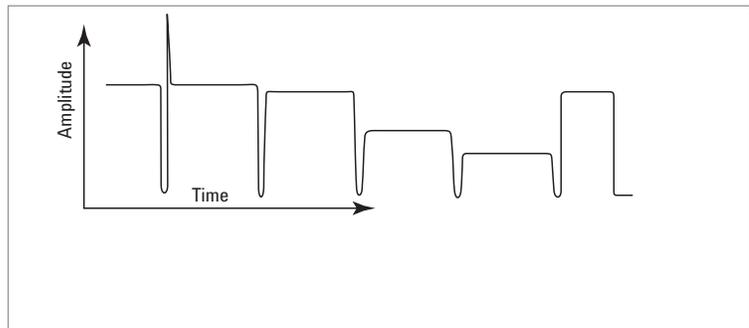


Figure 1. Power-versus-time measurement graph

## Power measurements (continued)

Average, pulse, and peak envelope power measurements provide different types of information about the signal (see Figure 2).

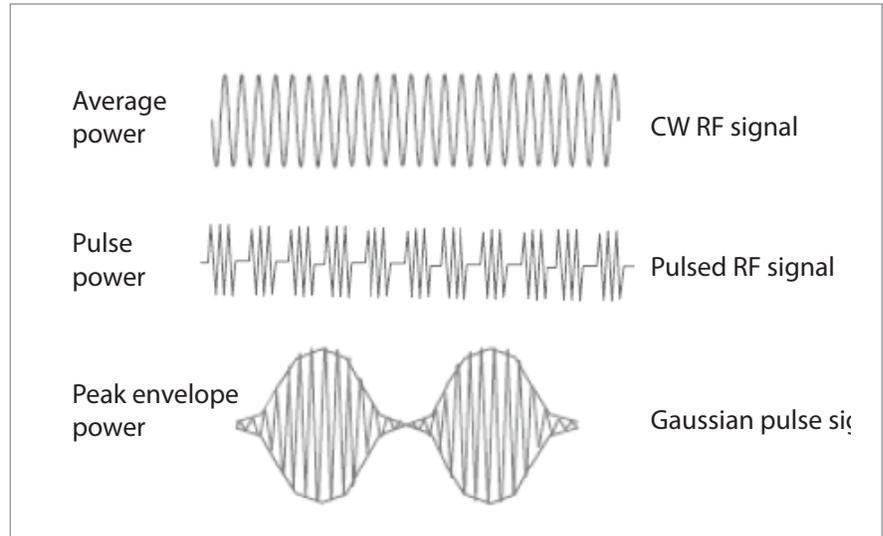


Figure 2. Average, pulse, and peak envelope signal power

Pulse power is determined by measuring the average power of the pulse and then dividing the result by the pulse duty cycle. This is a mathematical representation of the pulse power rather than an actual measurement and assumes constant pulse power. Pulse power measurement averages out any aberrations in the pulse, such as overshoot or ringing. For this reason, it is called pulse power and not peak power or peak envelope power. To ensure accurate pulse power readings, the modulating signal must be a rectangular pulse with a constant duty cycle. Other pulse shapes such as triangular or Gaussian will cause erroneous results. This technique is not applicable for digital modulation systems, where the duty cycle is not constant, and the pulse amplitude and shape varies.

When the power pulse becomes non-rectangular and the pulse-power measurement equations become inaccurate, using peak envelope power measurements is a better measurement method. This technique is the most suitable for modern digital communication systems with variable duty cycles and pulse widths.

Unlike measuring a pulsed signal that has a pulse repetition period and a constant duty cycle, burst signal measurement is considerably more challenging (see Figure 3). Measuring a burst signal with an unpredictable burst length that lacks a constant duty cycle requires time-gated functionality (independent measurement gates). This can be accomplished using high-performance power meters and power sensors.

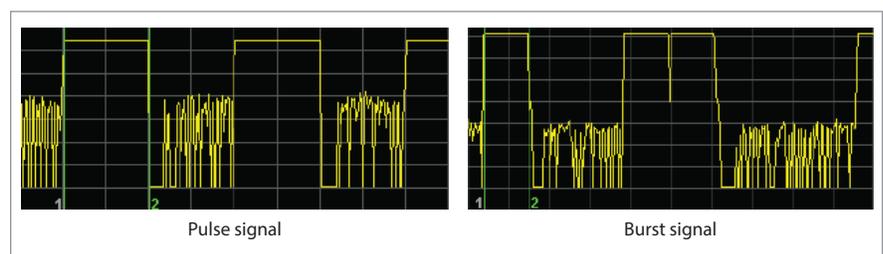


Figure 3. Pulse signal with a constant duty cycle versus burst signal without a constant duty cycle.

## Power measurements (continued)

Keysight power meters and power sensors offer the ability to measure CW and average power. The following example provides some tips for using power meters and power sensors to acquire an accurate power without increasing the test time.

## Querying tips

### Measurement query method

There are three different methods that can be used to query a measurement from the power meter or power sensor. It is beneficial to understand the basic differences between these three commands in order to fully optimize measurement speed.

#### MEASure?

This command is compound command consisting of ABORt, CONFIgure, and READ?. It is the simplest of the query commands because it relies on the power meter to select the best settings for the requested configuration and immediately perform the measurement. One drawback to this command is that its use results in a longer test time and overrides some of the power meter's settings, such as switching the meter from Free Run to Single Shot mode or changing the average count set to the ON state.

#### READ?

The READ? command is another compound command that is equivalent to an ABORt followed by an INITiate and FETCh?. The READ? query is similar to MEAS? in that it causes the meter to perform initializations and auto configuration. However, READ? gives users the flexibility to change certain settings such as the average count. The READ? command allows user to manipulate the settings in order to optimize the measurement speed, resulting in a shorter test time than that realized using the MEAS? command.

#### FETCh?

This command retrieves a reading upon measurement completion and puts it in the output buffer. The FETCh? command allows users to manipulate settings such as the average count. However, this command requires additional settling time to complete the average count process or else FETCh? will return invalid data.

### Measurement averaging

Measurement average count is primarily used to reduce signal noise in order to obtain better measurement accuracy, especially for a lower power signal. The power meter uses a digital filter to average the power readings. The number of readings averaged can range from 1 to 1,024. While increasing the number of measurements averaged reduces the measurement noise, the measurement time is increased. Users can manually configure the measurement average or keep the measurement average in Auto mode (the default). When the auto measurement average mode is enabled, the power meter automatically sets the number of readings averaged based on the power level currently being measured as defined by the power meter.

For example, a high power signal of +10 dBm requires a smaller average count for accurate measurement. The average count might set to "1" by default from the power meter. Using the FETCh? command to query +10 dBm power gives an accurate measurement upon completion of the average count process. The FETCh? command produces results faster than READ? and MEAS?.

## Querying tips (continued)

### Measurement query method (continued)

Conversely, at low power, a noisy signal of  $-40$  dBm requires a higher average count to reduce the noise. In this case, the power meter could, for example, select 128 for the average count. Using the FETCH? command, if insufficient WAIT time is specified for the meter, all 128 readings may not be obtained before the results are averaged and the final value returned. The FETCH? query is faster because it returns measurements with or without completion of the average count process. Using either the READ? or MEAS? query, 128 fresh readings would be taken and the average count process completed before returning a final average value however, the measurement speed would be slower than the FETCH? command.

**Command:**`FETCH?|READ?|MEAS?`**Command:**`SENSe:AVERAge:  
COUNT AUTO ON|OFF``SENSe:AVERAge:  
COUNT <numeric_value>`

Query Method	Pros	Cons
FETCH?	Faster speed. Accurate measurement at high power levels. Allows average count to be manually configured but requires defined settling time	Less accurate measurement especially at lower power level
READ?	Accurate measurement. Allows average count to be manually configured thus improving speed without a defined settling time	Slower speed than FETCH?
MEAS?	Accurate measurement	Slower speed. Does not allow manually-configured average count. Overrides some of the meter's settings

Table 1. Pros and cons of querying method

### Triggering mode

A power meter has a very flexible triggering system and it can be described as having three selectable modes: Free Run, Single Shot, or Continuous Trigger.

#### Free Run mode

In this mode the power meter takes measurements continuously without entering into the idle state. INITiate:CONTInuous is set to ON and TRIGger:SOURce is set to IMMEDIATE. In Free Run mode, the FETCH or MEAS command can be used to query the measurement.

#### Single Shot or Single Trigger mode

Here the power meter takes one reading and returns to idle state. INITiate:CONTInous is set to OFF and TRIGger:SOURce is set to IMMEDIATE. In Single Shot or Single Trigger mode, the INIT and FETCH, or READ? or MEAS commands can be used to query the measurement.

#### Continuous Trigger mode

Using this mode the power meter takes a new measurement after each detection of an INTERNAL or EXTERNAL trigger event, by setting the instrument to TRIGger:SOURce INTERNAL or EXTERNAL. Both internal and external triggers are used to capture the complex modulated burst signal, particularly to measure the time-gated average, peak, peak-to-average, and average of the burst signal.

## Querying tips (continued)

### Triggering mode (continued)

Trigger	TRIG:SOUR IMM		TRIG:SOUR INT EXT	
<b>Mode</b>	Free Run (INIT:CONT ON)	Single Shot (INIT:CONT OFF)	Continuous Trigger (INIT:CONT ON)	Continuous Trigger (INIT:CONT OFF)
<b>Query Method</b>				
FETCH?	FETCH?	INIT + FETCH?	FETCH?	INIT + FETCH?
READ?	–	READ?	–	READ?
MEAS?	MEAS?	MEAS?	MEAS?	MEAS?
<b>Description</b>	Continuously takes measurement	Take a measurement and then returns to IDLE state	Takes a measurement each time a trigger event is detected	Takes a measurement when a trigger event is detected and then returns to IDLE state
<b>Type of Power</b>	CW and average power		Time-gated average, peak, and peak-to-average power	

#### Command:

```
TRIGger:SOURce IMM|INT|EXT
```

Table 2. Triggering mode comparison and summary

### Average mode vs. Normal mode

Each power meter and power sensor provides two different detector functions: Average mode and Normal mode.

Average mode is used to measure CW, or modulated, repeatable signals. It involves chopping the signals (to reduce 1/f noise) and includes RC filtering, which helps to further reduce the noise of the measured signal. Measurement speed is determined by the measurement mode: Normal, Double, and Fast.

Normal mode is used to measure time-gated average, peak, peak-to-average, or average power. In Normal mode, there is no chopper (hence no 1/f noise reduction) and no RC filtering. The reason for this is that Normal mode is targeting non-periodic, modulated signals. RC filtering constants are impossible to derive and apply to those signals. Chopping, which generates spikes as a side effect, requires blanking by removing samples around chopping spikes—this would completely destroy the measured modulated signal and any information during that period. To offset those noise disadvantages, Normal mode allows user to specify the measurement interval and its position relative to internal or external trigger events.

Detector function mode	Average	Normal
<b>Type of power</b>	CW and average power	Time-gated average, peak, peak-to-average power
<b>Chopper and RC filter</b>	Enables reduction of signal noise	Disable
<b>Dynamic range</b>	+20 to –60 dBm (example)	+20 to –30 dBm (example)
<b>Gate length</b>	Disable	Allowed to configure various durations
<b>Measurement speed</b>	Determined by NORMAL, DOUBLE, or FAST mode	Determined by gate length. The longer the gate length the slower the measurement speed and vice versa
<b>Triggering mode</b>	Free run, single shot, and continuous external only	Free run, single shot, and continuous external only

Table 3. Comparison between Average mode and Normal mode

## Power sensor measurement speed

There are three possible measurement speed settings: Normal, Double, and Fast. The default speed setting is Normal. In Normal and Double speed modes, full instrument functionality is available and these settings can be used with all power sensors. Double speed mode is two times faster than Normal speed mode. Fast speed mode is the fastest measurement speed however, it provide less accurate measurements compared to Normal and Double speed mode due to limiting functions such as average count.

**Command:**

`SENSe:MRATe NORMAL|DOUBLE|FAST`

Measurement mode	Pros	Cons
Normal (by default)	Accurate measurement. Full function applied	Slower speed
Double	Accurate measurement. Full function applied and two times faster than normal speed mode	-
Fast	Faster speed than double speed mode	Less accurate measurement. Some functions are disabled (such as average count)

Table 4. Pros and cons of various measurement speed modes

## Test configuration and SCPI commands

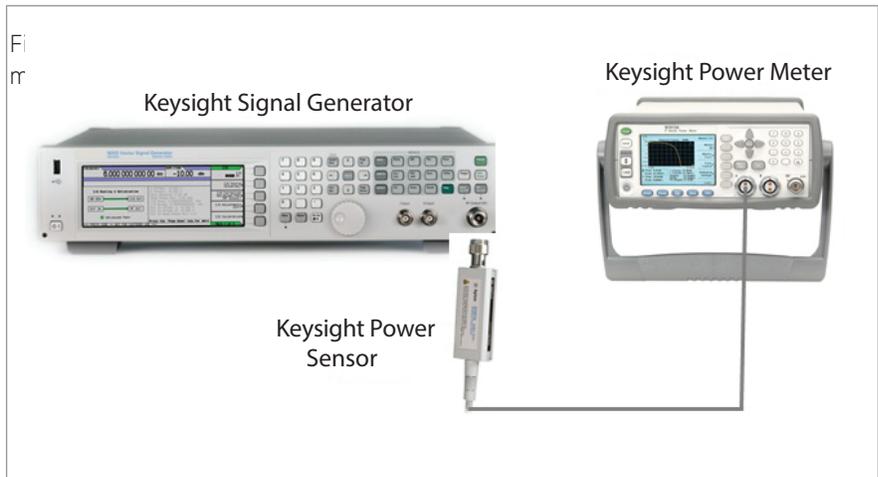


Figure 4. Configuration for obtaining CW and average power measurements

## Test configuration and SCPI commands (continued)

Measurement data is acquired using the following SCPI commands.

SCPI	Description
<b>Signal generator (Keysight ESG, PSG, EXT, and MXG)</b>	
SYST:PRES	Preset the instrument to its default settings
FREQ 1GHZ	Set frequency to 1 GHz (example)
POW:LEVEL 0DBM	Set output power to 0 dBm (example)
OUTP:STAT ON	Turn on RF output
<b>Power meter/sensor initialization</b>	
SYST:PRES	Preset the instrument to its default settings
SENS:FREQ 1GHZ	Set frequency to 1 GHz (example)
SENS:DET:FUNC AVERAGE	Set measurement to Average mode for CW/ Average power measurement
SENS:AVER:COUNT:AUTO ON or SENS:AVER:COUNT 1	Set average count to Auto mode (by default it is auto average count) Set the average count to 1
SENS:MRATE NORMAL	Set measurement speed mode to Normal speed (Normal is the speed mode default Normal)
<b>Querying CW/Average power</b>	
<b>Option 1: Query power in Free Run mode</b> INIT:CONT ON FETCH?	Set to Free Run mode. In this mode, return the measurement using FETCH?
<b>Option 2: Querying power in Single Trigger mode</b> INIT:CONT OFF READ?	Set to Single Trigger mode. In this mode, return the measurement using READ? or INIT + FETCH?

Table 5 illustrates the differences between these three modes using various Keysight power meters and power sensors.

Power sensor	Measurement speed mode		
	Normal (20 readings/s)	Double (40 readings/s)	Fast (readings/sec)
8480 and N8480 series	50 ms	25 ms	–
E-Series E4410 and E9300	50 ms	25 ms	Up to 400
E-Series E9320 (average mode)	50 ms	25 ms	Up to 400
E-Series E9320 (normal mode)	50 ms	25 ms	Up to 1000
P-Series wideband	50 ms	25 ms	Up to 1500
U2000A Series USB average	50 ms	25 ms	Up to 110
U2020XA Series USB peak	50 ms	25 ms	Up to 180
U8480A Series USB thermocouple	50 ms	25 ms	Up to 400

Table 6. Comparison of measurement speed modes by power sensor

## Conclusion

There are several ways to shorten the time it takes to acquire CW and average power measurements. Understanding the power meter's or power sensor's settings and available program commands plays a significant role in streamlining the data acquisition process. Keysight offers a variety of power sensors and power meters to provide measurement speed and data accuracy solutions for a range of budgets and application needs.


## Reference

*Keysight Practices to Optimize Power Meter/Sensor Measurement Speed and Shorten Test Time, application note, literature 5990-8471EN.*

## Evolving Since 1939

Our unique combination of hardware, software, services, and people can help you reach your next breakthrough. We are unlocking the future of technology.

From Hewlett-Packard to Agilent to Keysight.

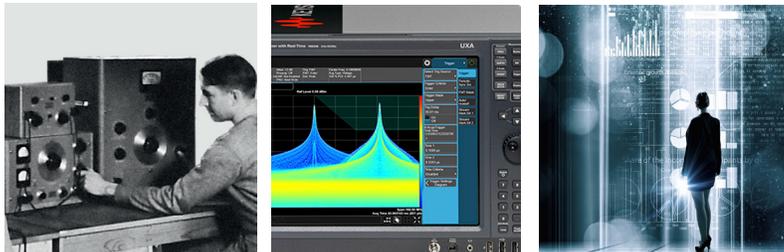

For more information on Keysight Technologies' products, applications or services, please contact your local Keysight office. The complete list is available at: [www.keysight.com/find/contactus](http://www.keysight.com/find/contactus)

### Americas

Canada	(877) 894 4414
Brazil	55 11 3351 7010
Mexico	001 800 254 2440
United States	(800) 829 4444

### Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 11 2626
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 6375 8100

### Europe & Middle East

Austria	0800 001122
Belgium	0800 58580
Finland	0800 523252
France	0805 980333
Germany	0800 6270999
Ireland	1800 832700
Israel	1 809 343051
Italy	800 599100
Luxembourg	+32 800 58580
Netherlands	0800 0233200
Russia	8800 5009286
Spain	800 000154
Sweden	0200 882255
Switzerland	0800 805353
	Opt. 1 (DE)
	Opt. 2 (FR)
	Opt. 3 (IT)
United Kingdom	0800 0260637

For other unlisted countries: [www.keysight.com/find/contactus](http://www.keysight.com/find/contactus) (BP-9-7-17)

**DEKRA Certified**  
ISO 9001 Quality Management System

[www.keysight.com/go/quality](http://www.keysight.com/go/quality)  
Keysight Technologies, Inc.  
DEKRA Certified ISO 9001:2015  
Quality Management System

### myKeysight

#### myKeysight

[www.keysight.com/find/mykeysight](http://www.keysight.com/find/mykeysight)

A personalized view into the information most relevant to you.

[http://www.keysight.com/find/emt\\_product\\_registration](http://www.keysight.com/find/emt_product_registration)

Register your products to get up-to-date product information and find warranty information.

### KEYSIGHT SERVICES

Accelerate Technology Adoption.  
Lower costs.

#### Keysight Services

[www.keysight.com/find/service](http://www.keysight.com/find/service)

Keysight Services can help from acquisition to renewal across your instrument's lifecycle. Our comprehensive service offerings—one-stop calibration, repair, asset management, technology refresh, consulting, training and more—helps you improve product quality and lower costs.

#### Keysight Assurance Plans

[www.keysight.com/find/AssurancePlans](http://www.keysight.com/find/AssurancePlans)

Up to ten years of protection and no budgetary surprises to ensure your instruments are operating to specification, so you can rely on accurate measurements.

#### Keysight Channel Partners

[www.keysight.com/find/channelpartners](http://www.keysight.com/find/channelpartners)

Get the best of both worlds: Keysight's measurement expertise and product breadth, combined with channel partner convenience.

[www.keysight.com/find/ad](http://www.keysight.com/find/ad)



This information is subject to change without notice.  
© Keysight Technologies, 2017  
Published in USA, December 2, 2017  
5991-2641EN  
[www.keysight.com](http://www.keysight.com)